



Applies To: **2007 Element With 2WD** – From VIN 5J6YH1...7L000001 thru 5J6YH1...7L007749
2007 Element With 4WD – From VIN 5J6YH2...7L000001 thru 5J6YH2...7L005730

October 5, 2007

Front Passenger's Seat Base Cover Is Loose

SYMPTOM

The recline cover on the base of the front passenger's seat is loose.

PROBABLE CAUSE

The clip on the cover is not strong enough to hold it in place.

CORRECTIVE ACTION

Replace the clip with an improved part, or replace both the cover and the clip if the cover is damaged.

PARTS INFORMATION

Clip (black): P/N 90661-SDB-A71,
(Use if cover is *not* damaged.) H/C 7822349

Recline Cover (right side): P/N 81238-SCV-L01ZA,
(Use only if old cover is damaged during removal.) H/C 8399396

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 8611A0

Flat Rate Time: 1.0 hour

Failed Part: P/N 81238-SCV-L01ZA
H/C 8399396

Defect Code: 05701


Symptom Code: 01801

Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

1. Remove the recline cover:
 - Refer to page 20-108 of the *2007–2008 Element Service Manual*, or
 - Online, enter keywords **FRONT SEAT**, and select **Front Seat Cushion Cover Replacement** from the list.

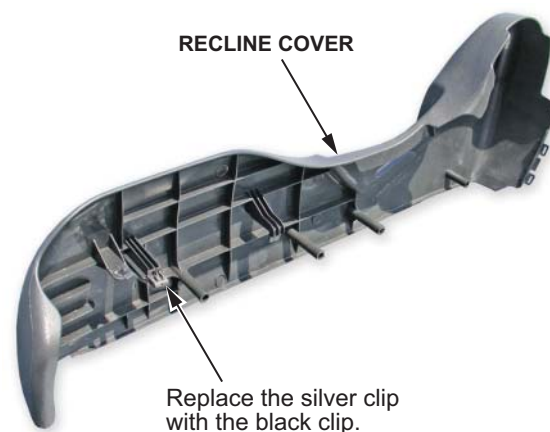

2. Inspect the cover for damage:
 - If the cover is not damaged, replace the silver trim clip with a new black clip, and reinstall the cover (*do not replace it*).
 - If the cover is damaged, replace it (it already has the new clip attached).